

ZyXEL G-202

Release Vista Driver 2.0.2.5

Release Notes

Date: June.14, 2007

Supported Platforms:

Window98 SE, Window ME, Windows 2000, Windows XP, Windows XP 64-bit,
Windows Vista32, Windows Vista64

Driver version:

03/29/2006 6.6.0.0

05/11/2007 2.0.2.5(Vista)

Limitation

1. (SoftAP Mode) SoftAP didn't support power save mode. **SPRID** 060328356
2. Connect the AP with the encryption of 802.1X, that can't configure in "Site Survey" page.
3. (SoftAP Mode) Open System/Shared Key of WEP is the same with Auto.
4. (InstallShield) G-220 v2 and G-202 install the same PC. When uninstall G-220 v2 or G-202, another device couldn't work fine. **SPRID** 060328362

Known issue:

1. On Win98SE OS, sometimes while user unplug and plug the DUT, the PC will find a new hardware again. After installed again, there're two G-220 v2 name in Network Neighborhood. This should be involved with 98SE OS response time issue.
2. In normal user account. The AP mode didn't work normally. DUT can't connect to the AP with WPA/WPA2/WPA-PSK/WPA2-PSK/802.1x encryption. **SPRID** 060328353
3. Under Vista while setting two AP to the same SSID and same encryption, in Scanlist only can display one.

Note:

1. Utility is not supported under Vista 32/64bit OS.

Features:

Modification in 2.0.2_Vista | 06/14/2007

1. Driver Changed.

1. [Modify] Add vista driver cat file.

2. Utility Changed.

N/A

Modification in 2.0.2_Vista b3 | 06/06/2007

1. Driver Changed.

1. [Modify] update vista driver version to 2.0.2.5.

2. Utility Changed.

N/A

Modification in 2.0.2_Vista b2 | 05/21/2007

1. Driver Changed.

1. [Modify] update vista driver version to 2.0.2.4.

2. Utility Changed.

N/A

Modification in 2.0.2_Vista b1 | 02/08/2007

1. Driver Changed.

1.1 [Modify] Add Vista32 and Vista64 driver

2. Utility Changed.

N/A

Modification in 2.0.2 | 11/30/2006

1. Driver Changed.

N/A

2. Utility Changed.

2.1 MultiLanguage base on 2.0.2 beta1.

Modification in 2.0.2b1 | 11/03/2006

1. Driver Changed.

1.1 Open the PSP X-Link configured interface at driver advanced and set default to disable.

1.2 Open WMM function configured interface at driver advanced and set default to enable.

1.3 Add cat file.

2. Utility Changed.

2.1 The WMMQos item should be checked by default on utility.

Modification in 2.0.1 | 09/30/2006

1. Driver Changed.

N/A

2. Utility Changed.

2.1 MultiLanguage base on beta3.

Modification in 2.0.1b3 | 09/28/2006

1. Driver Changed.

N/A

2. Utility Changed.

- 2.1 [Bug Fixed] In Trend Chart page, TX and RX value are identical.
- 2.2 [Bug Fixed] AutoRun.exe program is invalid in Win98 and WinMe.
- 2.3 [Bug Fixed] **SPRID** 060328359
In XP 64bit OS, after uninstall, the "WlanUZ64.sys" didn't removed.

Modification in 2.0.1b2 | 09/13/2006

1. Driver Changed.

N/A

2. Utility Changed.

- 2.1 [Bug Fixed] **SPRID** 060329464
After pull and plug DUT or changed to station mode. The "Bridge" function in AP mode didn't work.
- 2.2 [Bug Fixed] The files W32BRG55 and W32BRG55.dll can't be removed.
- 2.3 [Bug Fixed] In AP mode. When DUT set no security. STA could connect to AP with WEP.
- 2.4 [Bug Fixed] In ad-hoc mode, Transmission Rate and Wireless Mode can't display correctly.
- 2.5 [Bug Fixed] The Profile--> Profile Info couldn't show max SSID characters information.

3.Install Shield Changed.

- 3.1 [Bug Fixed] Install UI and driver by IS, then uninstall UI and driver, pull and plug WNIC, it will appear code 39 in Device Manager.

Modification in 2.0.1b1 | 08/25/2006

1. Driver Changed.

N/A

2. Utility Changed.

- 2.1 [Modify] **SPRID** 060613793
Remove the Mixed item on adhoc.
- 2.2 [Bug Fixed] The ":" of the "Channel:" in "Site Survey" page should be deleted.
- 2.3 [Bug Fixed] First install driver manually, second use UI to install Utility (don't select driver check button), and then uninstall utility. The driver can not be uninstalled.
- 2.4 [Bug Fixed] When run the Traditional Chinese.exe. You could find that the product name was showed G202. It lost one character "-". It should show G-202.
- 2.5 [Bug Fixed] When run the Traditional Chinese.exe that shows CRC Error.
- 2.6 [Bug Fixed] When run the German.exe that shows CRC Error (Refer to German1.gif and German2.gif), and because of the CRC Error, the Utility can't be opened.
- 2.7 [Bug Fixed] When run the Italian.exe that the UI layout not so good.
- 2.8 [Bug Fixed] In Italian language, that show a wrong character "?".
- 2.9 [Bug Fixed] **SPRID** 060614861
On WPA2 setting, while changing Station Mode to AP Mode, and click "save" in "Configuration" page, sometimes the message of "LinkInfo" also display the message of Station Mode.
- 2.10 [Bug Fixed] When restart PC, the SSID in the "Link Info" page can not be displayed.

Modification in 2.0.1 date version| 08/23/2006

1. Driver Changed.

N/A

2. Utility Changed.

2.1 [Modify] SPRID 060711593

Open the WMM function on UI

2.2 [Modify] Update pcausa

2.3 MultiLanguage

Modification in 2.0.0 | 06/21/2006

1. Driver Changed.

1.1 [Modify] Upgrade driver to 6.6.0.0.

2. Utility Changed.

2.1 [Bug Fixed] While uninstalling the software, do not remove the whole ZyXEL folder and only remove the ZyXEL G-202... Folder.

2.2 [Bug Fixed] Multilingual software.

Modification in 2.0.0b1 | 05/26/2006

1. Driver Changed.

1.1 [Modify] Update driver.

2. Utility Changed.

N/A

3.Install Shield Changed.

3.1 [Bug Fixed] Fix IS bug.

Modification in 1.0.0 | 04/12/2006

1. Driver Changed.

N/A

2. Utility Changed.

2.1 MultiLanguage OEM.

Modification in 1.0.0b2 | 03/17/2006

1. Driver Changed.

N/A

2. Utility Changed.

N/A

3.Install Shield Changed.

3.1 [Bug Fixed] Fix the IS's UI bug.

Modification in 1.0.0b1 | 03/15/2006

1. Driver Changed.

N/A

2. Utility Changed.

2.1 First release base on ZyXEL G-220 v2.